


# Hygro-Thermograph

## Instruction for Use

1.0660.../ 1.0664.../ 1.0665...

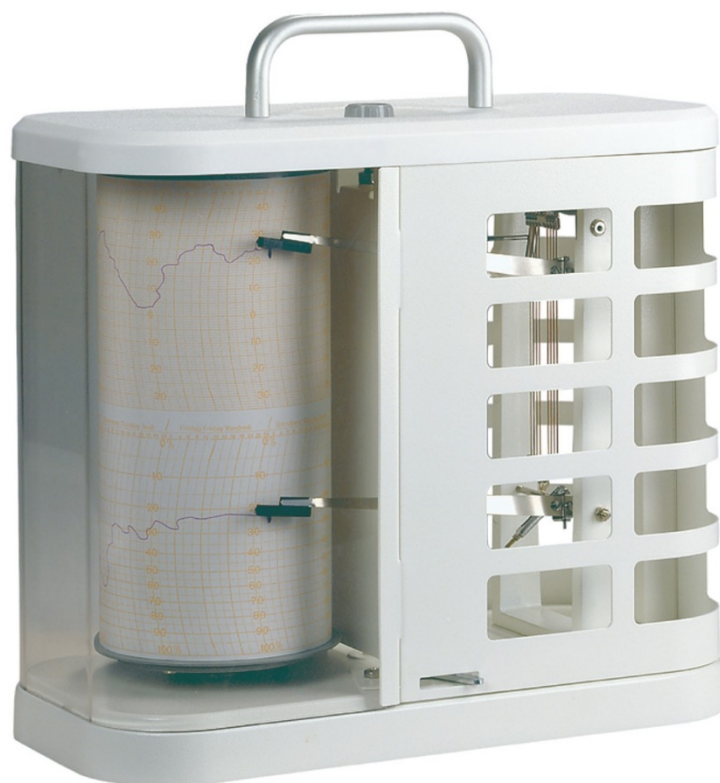

Dok. No. 020659/05/22

THE WORLD OF WEATHER DATA

## Contents

1	Models available .....	2
2	Application .....	3
3	Set-up and Mode of Operation .....	3
4	Preparation for Use .....	4
5	Maintenance .....	5
5.1	Changing the recording strip .....	5
5.2	Changing the recording pens .....	6
5.3	Regenerating the humidity measuring element .....	6
5.4	Checking the bimetallic setting .....	7
6	Technical Data .....	8
7	Scale Drawing .....	9
8	EC-Declaration of Conformity .....	10
9	UK-CA-Declaration of Conformity .....	11

## Figures

Figure 1: Hygro - Thermograph .....	4
-------------------------------------	---

## Tables

Table 1: models available .....	2
Table 2: Recording Strips .....	6

## 1 Models available

Order-No.	Recording Time	Clockwork
1.0660.xx.xxx	1 day / 7 days, switchable	Spring clockwork mechanism
1.0664.xx.xxx	14 days / 31 days, switchable	Spring clockwork mechanism
1.0665.xx.xxx	1 / 7 / 31 days, switchable	Quartz clockwork mechanism
	Humidity measuring range	
...00...	H (10...100% rel.h. ; -35...+80°C)	
...02...	K ( 0...100% rel.h. ; 0...+80°C)	
	Temperature measuring range	Graduation
...000	-35 ... +45°C	1 °C
...005	-20 ... +60°C	1 °C
...011	-10 ... +50°C	1 °C
...014	0 ... +40°C	0,5°C
...015	0 ... +50°C	0,5°C
...017	0 ... +80°C	1 °C

**Table 1: models available**

**Attention:**

***Hygro- Thermographs with Quartz clockwork mechanism are applicable only within a temperature range from –20 to +60°C!***

## 2 Application

---

The hygro-thermograph measures and records both the relative humidity and the air temperature of the surrounding atmosphere. The recording drum is driven with utmost precision either by a manual spring clockwork mechanism or by a battery-operated quartz clockwork. Either H or K humidity measuring elements can be used depending on the general on-site operating conditions.

**"H" measuring elements** are suitable for taking measurements in normal to very moist air at temperatures below and above 0°C.

**"K" measuring elements** are designed for use in normal to dry air in the temperature range above 0°C and require no maintenance.

Typical applications include environmental monitoring in computer rooms, factories, warehouses, offices, laboratories, nurseries, museums and galleries but they can also be used in meteorological measuring stations.

## 3 Set-up and Mode of Operation

---


The clockwork and the columns with the humidity measuring element and the temperature measuring element are mounted to a base plate. The instrument is protected by a tiltable transparent hood. The measuring elements react promptly thanks to large ventilation openings in the direction of measurement.

Humidity is measured by a hair (H) or by a synthetic (K) measuring element. These measuring elements consist of several hairs or fibres whose lengths change when the humidity changes. This change in length is recorded by a felt pen onto a paper recording strip via a system of levers. The measurement accuracy indicated for the H measuring element applies to regenerated measuring elements in decreasing humidity.

Temperature is measured by a high quality, aged bimetallic measuring element which has been bent to form a ring. The radius of the measuring element changes when the temperature changes. This change in radius is likewise recorded on the recording strips. The rotation of the drum allows time-dependent registration.

## 4 Preparation for Use


Unscrew the knurled-head screw and open the hood. Remove the foam rubber from the hood (transport protection). Push the switch-off lever to the left to raise the recording pens from the recording strip.

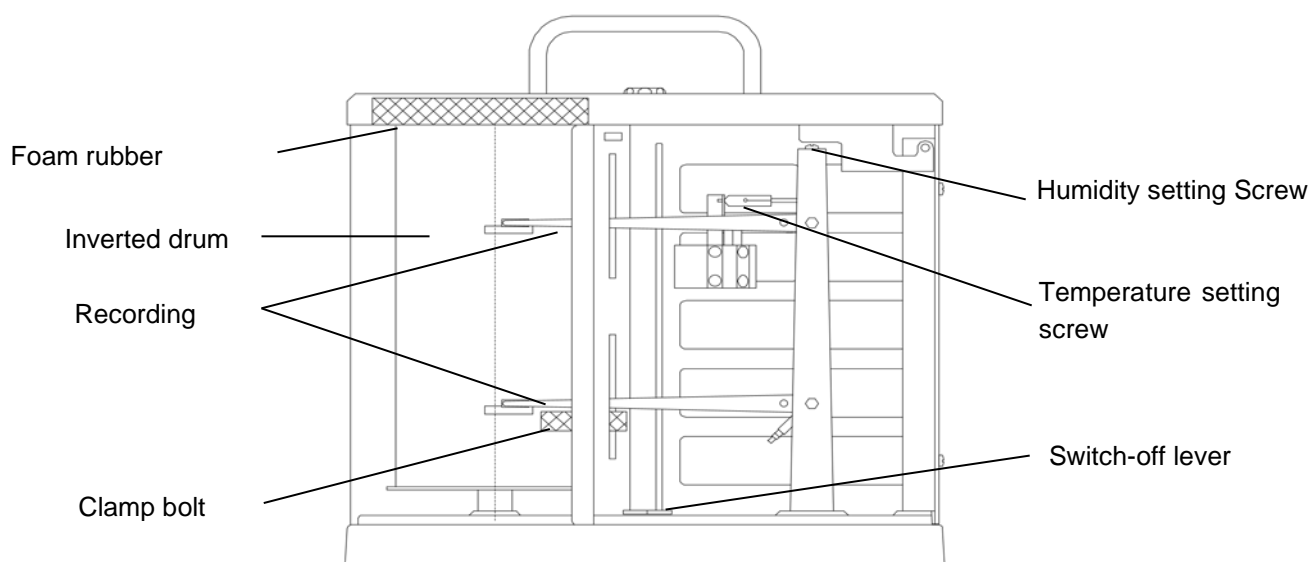

**Figure 2: Hygro - Thermograph**

Setting the desired recording time


For instruments with a spring clockwork mechanism, unscrew the winding key by turning it towards the right and remove the inverted drum from the drive mechanism. The desired recording time can be set by changing the interchangeable gear wheel on the drum.

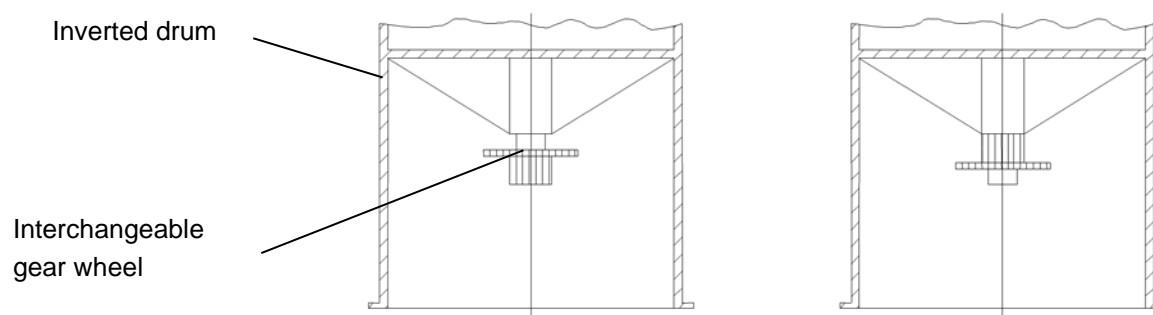

Order No.	Recording time	Recording time
1.0660.xx.xxx	1 day	7 days
1.0664.xx.xxx	14 days	31 days

Instrument with Quartz Clockwork.

Remove the inverted drum from the drive mechanism and set the recording time with the red gear wheel by clicking it into place at the appropriate height. Make sure that the yellow gear wheel is properly engaged. Place the enclosed battery into the recess provided with the poles in the correct direction.

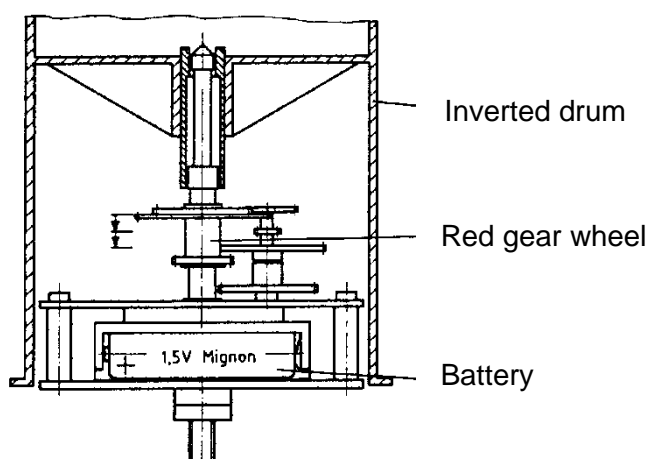

Position of the red gear wheel	
up	7 days
middle	31 days
down	1 day

Place the recording strip onto the inverted drum (see 6.1 Changing the recording strip) and insert this onto the drive mechanism until it locks into place!

Remove the lower recording arm from the clamp bolt (transport safety device). Remove the tip protector from the felt pen. For instruments with a spring clockwork mechanism, wind the clockwork with the key in the drum, turning it to the left. Rotate the drum counter clockwise to the correct time. Close the hood and screw the knurled-head screws back into place. Press the switch-off lever to the right stop in order to lower the recording pens onto the recording strip.

## 5 Maintenance

### 5.1 Changing the recording strip

This should be done regularly at the time where the recording strip starts; for example if you are using a 7 day recording period, then change the strip every Monday morning. After swinging the recording arm forwards, raise the chart holder and remove the recording strip. Place the new recording strip onto the drum and fix it into position by inserting the chart holder. Make sure that the new recording strip fits snugly and smoothly against the lower edge of the drum. Rewind the clockwork mechanism every time you change the recording strip. Swing the recording arms back to their original position and rotate the drum counter clockwise to the correct time. The instrument is now ready for use.

**Recording Strips** (1 set = 100 sheets), order-no. key

°C	"H" Measuring element				"K" measuring element			
	1 day	7 days	14 days	31 days	1 day	7 days	14 days	31 days
-35...+45	205142	205086	205153	205169				
-20...+60	205143	205088	205158	205168				
-10...+50	205138	205092	205155	205166				
0...+40	205123	205094	205150	205160	205131	205097	205151	205161
0...+50	205124	205095			205132	205110		
0...+80	205126	205103	205280	205281	205134	205112	205282	205283

**Table 2: Recording Strips**

## 5.2 Changing the recording pens

Remove the recording pens carefully from the recording arms. Remove the tip protection from the new pen. Make sure that you do not touch the recording tip when you place the new pen into position.

**Spare Recording pens** (minimum order of 6) Order-No. 500 847

## 5.3 Regenerating the humidity measuring element

"H" measuring elements dry out when the relative humidity is less than 60%. This results in an increase in the zero point of approximately 5% or more rel. humidity. At ca. 60% rel. humidity, maximum inaccuracy is reached in 3 weeks. This time is shorter when the humidity value is even lower. Accuracy can be restored by regeneration. Simply place the instrument in saturated air for some hours. At the conclusion of the regeneration process, check whether the measuring element has returned to 95% rel. humidity. This value can be set on the humidity setting screw.

Measuring elements which are located out-of-doors or in huts regenerate automatically because the central European climate is such that, particularly at night - humidities of 95% occur.

---

*"K" measuring elements do not degenerate, and consequently do not have to be regenerated.*

---

## 5.4 Checking the bimetallic setting

The accuracy of the bimetallic element is checked by carrying out a comparative measurement. In a temperature-constant room hang a precision mercury thermometer next to the hygro-thermograph. Allow about 20 minutes adjustment time and then compare the temperature values. If a correction is necessary, do this with the aid of the temperature setting screw on the bimetallic element.


## 6 Technical Data

<b>Humidity</b>	
Measuring range	10 ... 100% rel. humidity "H"
	0 ... 100% rel. humidity "K"
Graduation	5% rel. humidity
Temp.- working range	-35 ... +70°C "H"
	0 ... +80°C "K"
Measurement accuracy	± 2% rel. humidity "H" + 1 Scale graduation @ 65% rel. h. and room temperature
	± 3% rel. humidity "K" + 1 Scale graduation @ 65% rel. h. and room temperature
<b>Temperature</b>	
Measuring range	-35 ... +80°C (see models available)
Graduation	1°C bzw. 0.5°C (see models available)
Measurement accuracy	± 1% of measuring range + 1 Scale graduation
<b>Clockwork</b>	
Spring clockwork mechanism	
Recording time	1 day / 7 days resp.
	14 days / 31 days; (see models available)
Thrust	11.45mm/h.; 40.01mm/day resp.
	20mm/day; 9mm/day
Temperature range	-35 ... +80°C
Gear accuracy	± 60s/day at 20°C acc. to DIN 8300
<b>Quartz clockwork</b>	
Recording time	1 day / 7 days / 31 days
Thrust	11,45mm/h.; 40,01mm/h; 9mm/h
Temperature range	-20 ... +60°C similar to DIN 8300 B
Gear accuracy	± 2s/day
Battery capacity	> 1 year at 20°C (mignon battery 1,5 V)
<b>Generally</b>	
Clockwork drum	S 93 x 186 similar to DIN 58658
Recording strip	Similar to DIN 16232
Recording width	2 x 82mm
Weight	2.7kg



## 7 Scale Drawing

---

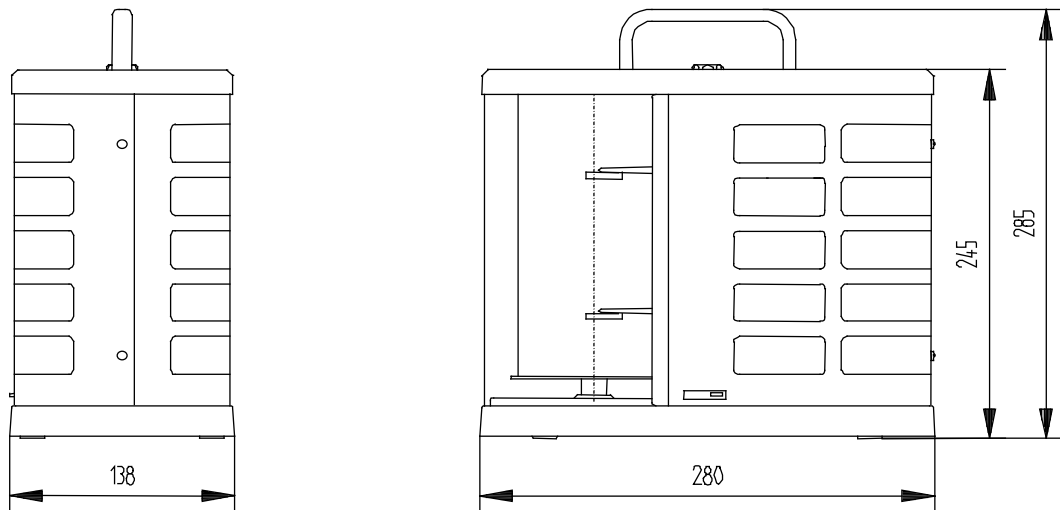

## 8 EC-Declaration of Conformity

**Manufacturer:** Adolf Thies GmbH & Co. KG  
 Hauptstraße 76  
 37083 Göttingen, Germany  
<http://www.thiesclima.com>

**Product:** Hygro - Thermograph

Doc. Nr. 252-44690\_CE

**Article Overview:**

1.0660.00.000	1.0660.00.005	1.0660.00.011	1.0660.00.014	1.0660.00.015	1.0660.00.017	1.0660.02.000	1.0660.02.014	1.0660.02.017	1.0660.02.011	1.0660.02.017
1.0664.00.000	1.0664.00.005	1.0664.00.011	1.0664.00.014	1.0664.00.015	1.0664.00.017	1.0664.02.000	1.0664.02.005	1.0664.02.011	1.0664.02.014	1.0664.02.017
1.0664.02.015	1.0664.02.017	1.0665.00.000	1.0665.00.005	1.0665.00.011	1.0665.00.014	1.0665.00.015	1.0665.02.000	1.0665.02.005	1.0665.02.011	1.0665.02.017
1.0665.02.014	1.0665.02.015	1.0665.02.017	1.0660.02.005	1.0660.02.011						

The indicated products correspond to the essential requirement of the following European Directives and Regulations:

2014/30/EU	26.02.2014	DIRECTIVE 2014/30/EU OF THE EUROPEAN PARLIAMENT AND OF THE COUNCIL of 26 February 2014 on the harmonisation of the laws of the Member States relating to electromagnetic compatibility.
2014/35/EU	26.02.2014	DIRECTIVE 2014/35/EU OF THE EUROPEAN PARLIAMENT AND OF THE COUNCIL of 26 February 2014 on the harmonisation of the laws of the Member States relating to the making available on the market of electrical equipment designed for use within certain voltage limits.
2017/2102/EU	15.11.2017	DIRECTIVE (EU) 2017/2102 of the European Parliament and of the Council of November 15, 2017 amending Directive 2011/65 / EU on the restriction of the use of certain hazardous substances in electrical and electronic equipment.
2012/19/EU	13.08.2012	DIRECTIVE 2012/19/EU OF THE EUROPEAN PARLIAMENT AND OF THE COUNCIL of 4 July 2012 on waste electrical and electronic equipment (WEEE).

The indicated products comply with the regulations of the directives. This is proved by the compliance with the following standards:

DIN EN 61000-6-2	2019-11	Electromagnetic compatibility Immunity for industrial environment
DIN EN 61000-6-3:2007 + A1:2011	2011-09	Electromagnetic compatibility (EMC). Generic standards. Emission standard for residential, commercial and light-industrial environments
DIN EN 61010-1	2020-03	Safety requirements for electrical equipment for measurement, control, and laboratory use. General requirements
DIN EN 63000	2019-05	Technical documentation for the assessment of electrical and electronic products with respect to the restriction of hazardous substances.

Legally binding signature:



General Manager - Dr. Christoph Peper

Legally binding signature:



Development Manager - ppa. Jörg Petereit

This declaration certifies the compliance with the mentioned directives, however does not include any warranty of characteristics.  
 Please pay attention to the security advises of the provided instructions for use.

## 9 UK-CA-Declaration of Conformity

**Manufacturer:** Adolf Thies GmbH & Co. KG  
 Hauptstraße 76  
 37083 Göttingen, Germany  
<http://www.thiesclima.com>

**Product:** Hygro - Thermograph

Doc. Nr. 252-44690\_CA

**Article Overview:**

1.0660.00.000	1.0660.00.005	1.0660.00.011	1.0660.00.014	1.0660.00.015	1.0660.00.017	1.0660.02.000	1.0660.02.014	1.0660.02.017
1.0664.00.000	1.0664.00.005	1.0664.00.011	1.0664.00.014	1.0664.00.015	1.0664.00.017	1.0664.02.000	1.0664.02.005	1.0664.02.014
1.0664.02.015	1.0664.02.017	1.0665.00.000	1.0665.00.005	1.0665.00.011	1.0665.00.014	1.0665.00.015	1.0665.02.000	1.0665.02.011
1.0665.02.014	1.0665.02.015	1.0665.02.017	1.0660.02.005	1.0660.02.011				

The indicated products correspond to the essential requirement of the following Directives and Regulations:


1091	08.12.2016	The Electromagnetic Compatibility Regulations 2016
1101	08.12.2016	The Electrical Equipment (Safety) Regulations 2016
RoHS Regulations 2012	01.01.2021	The Restriction of the Use of Certain Hazardous Substances in Electrical and Electronic Equipment Regulations 2012
3113	01.01.2021	Regulations: waste electrical and electronic equipment (WEEE)

The indicated products comply with the regulations of the directives. This is proved by the compliance with the following standards:

BS EN IEC 61000-6-2	25.02.2019	Electromagnetic compatibility (EMC). Generic standards. Immunity standard for industrial environments
BS EN IEC 61000-6-3	30.03.2021	Electromagnetic compatibility (EMC). Generic standards. Emission standard for equipment in residential environments
BS EN 61010-1+A1	31.03.2017	Safety requirements for electrical equipment for measurement, control, and laboratory use. General requirements
BS EN IEC 63000	10.12.2018	Technical documentation for the assessment of electrical and electronic products with respect to the restriction of hazardous substances

This declaration of conformity is issued under the sole responsibility of the manufacturer.

Legally binding signature:



General Manager - Dr. Christoph Peper

Legally binding signature:



Development Manager - ppa. Jörg Peterleit

This declaration certifies the compliance with the mentioned directives, however does not include any warranty of characteristics.

Please pay attention to the security advises of the provided instructions for use.

**Please contact us for your system requirements.  
We advise you gladly.**

**ADOLF THIES GMBH & CO. KG**

Meteorology and environmental metrology  
Hauptstraße 76 · 37083 Göttingen · Germany  
Phone +49 551 79001-0 · Fax +49 551 79001-65  
info@thiesclima.com

[www.thiesclima.com](http://www.thiesclima.com)

